

# Single Survey

survey report on:

Property address	FLAT E 6 HOSEFIELD ROAD ABERDEEN AB15 5NB
Customer	Mr Steve Hardie
Customer address	C/o Mackie and Dewar 18 Bon Accord Square Aberdeen AB11 6YP
Prepared by	DM Hall LLP
Date of inspection	29th March 2018



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The property comprises a second floor (top) flat within a three storey block containing six flats in all.
<b>Accommodation</b>	Second Floor: Entrance hallway, living room, dining kitchen, bedroom and family bathroom.
<b>Gross internal floor area (m<sup>2</sup>)</b>	53 m2 approximately.
<b>Neighbourhood and location</b>	The property is situated within an established private and popular residential area within Midstocket, to the north west of Aberdeen City Centre. The location is convenient for local amenities.
<b>Age</b>	120 years approximately.
<b>Weather</b>	Dry and overcast. The report should be read in this context.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  There are stone built chimney stacks, pointed externally with cement and lead flashings.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b>  <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b>  <b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b>  Roof: The roof is pitched and of a Mansard profile design clad with slates and with cement skewers where the roof slopes meet the upstand walls. There is a metal ridge clipped into position.



# Single Survey

	<p>Roof Space: The roof space was inspected through a ceiling hatch to the communal attic level landing.</p> <p>This inspection was restricted to a head and shoulders inspection around the hatch position only and revealed a timber framed roof structure with timber sarking and with under- slate felt material. Thick glass wool quilt insulation has been laid between the ceiling joists.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The rainwater goods are formed in a mixture of cast iron and PVC materials. There is Ogee style guttering to the front elevation.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are of solid granite construction, pointed externally.</p> <p>It is appreciated that the flat is formed within the roof structure of the block.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Windows: The windows are of replacement PVC framed and double glazed design.</p> <p>External Doors: The entrance door to the flat is of timber frame design. There are timber framed and panelled front and rear entrance doors to the communal block.</p> <p>Joinery: There are timber and PVC features around dormer projections.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>External decorations are painted or PVC finished.</p>
<b>Conservatories / porches</b>	<p>None.</p>

# Single Survey

<b>Communal areas</b>	<p><b>Circulation areas visually inspected.</b></p> <p>The block is set within communal gardens grounds.</p> <p>The block is accessed through a timber framed entrance door with security entry system which leads into a communal hallway. This hallway comprises timber floors with lath and plaster and plaster wall and ceiling finishes and with PVC framed double glazed window units to the half-landings. There is an internal staircase leading from ground floor level to the upper levels.</p>
<b>Garages and permanent outbuildings</b>	<p><b>Visually inspected.</b></p> <p>There is a small former coal cellar which is of a brick and stone construction beneath a mono- pitched and slate covered roof. There is also a communal wash house of a similar stone and slate construction.</p> <p>There is a former air-raid shelter in the rear garden.</p>
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>It is understood that the front area of garden ground pertains to ground floor flat only. There is a path leading from pavement to the entrance door.</p> <p>To the rear of the block the garden ground is communal and laid to lawn with concrete hardstanding site paths, areas of stone chips and with boundaries defined by a pointed stone wall.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>The ceilings are of timber lath and plaster and ceiling joists, lined in plasterboard.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls are of timber lath and plaster and stud, lined in plasterboard.</p>
<b>Floors including sub floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>Flooring is of a suspended timber construction overlaid with timber floorboards. There are fitted floor coverings installed.</p> <p>Sub-Floor: There is no sub-floor void.</p>

# Single Survey


Internal joinery and kitchen fittings	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>The internal joinery finishes are of timber.</p> <p>The interior doors are of timber framed and panelled design.</p> <p>The kitchen is fitted with a range of floor standing and wall mounted units.</p>
Chimney breasts and fireplaces	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>There is a fireplace in the living room which has been blocked over.</p> <p>Any other original fireplaces have been removed and blocked over.</p>
Internal decorations	<p><b>Visually inspected.</b></p> <p>The internal decorations comprise painted, papered or tiled finishes.</p>
Cellars	<p>None.</p>
Electricity	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply.</p> <p>The electricity meter and fuse box are wall mounted in the entrance hallway within the flat. Visible wiring is of PVC coated cabling with 13amp sockets.</p>
Gas	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply.</p> <p>The gas meter is floor standing in an alcove cupboard below the living room window.</p>

# Single Survey

<p><b>Water, plumbing, bathroom fittings</b></p>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains water supply.</p> <p>The family bathroom comprises a panel bath with shower over, low level wc and wash hand basin.</p> <p>There is a one-and-a-half bowl stainless steel sink unit with drainer in the kitchen.</p> <p>All visible pipework is formed in copper and PVC materials.</p>
<p><b>Heating and hot water</b></p>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a gas fired Viessmann Vitodens 100 central heating boiler, wall mounted in a bathroom cupboard. This boiler supplies steel panelled radiators and also provides the domestic hot water.</p>
<p><b>Drainage</b></p>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage is connected to the main public sewer.</p>
<p><b>Fire, smoke and burglar alarms</b></p>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>It is imperative that, where not already fitted, suitable smoke alarms are installed and thereafter regularly tested.</p>
<p><b>Any additional limits to inspection</b></p>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>The property was occupied, furnished with floors covered. The visual inspection of the roof void was restricted to a head and</p>

	<p>shoulders inspection around the hatch position only and was further restricted by insulation material.</p> <p>No access was available to the external former coal cellar, wash house or air raid shelter.</p> <p>The external inspection was restricted due to site boundaries and some sections of roof covering could not be seen.</p> <p>I have not disturbed insulation in accordance with Health and Safety Guidelines and furniture, personal effects (particularly in cupboards) and floor coverings have not been moved.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of this report, I have assumed that there is no Japanese Knotweed within the boundaries of the property, or in neighbouring properties.</p>
--	---

## Sectional Diagram showing elements of a typical house

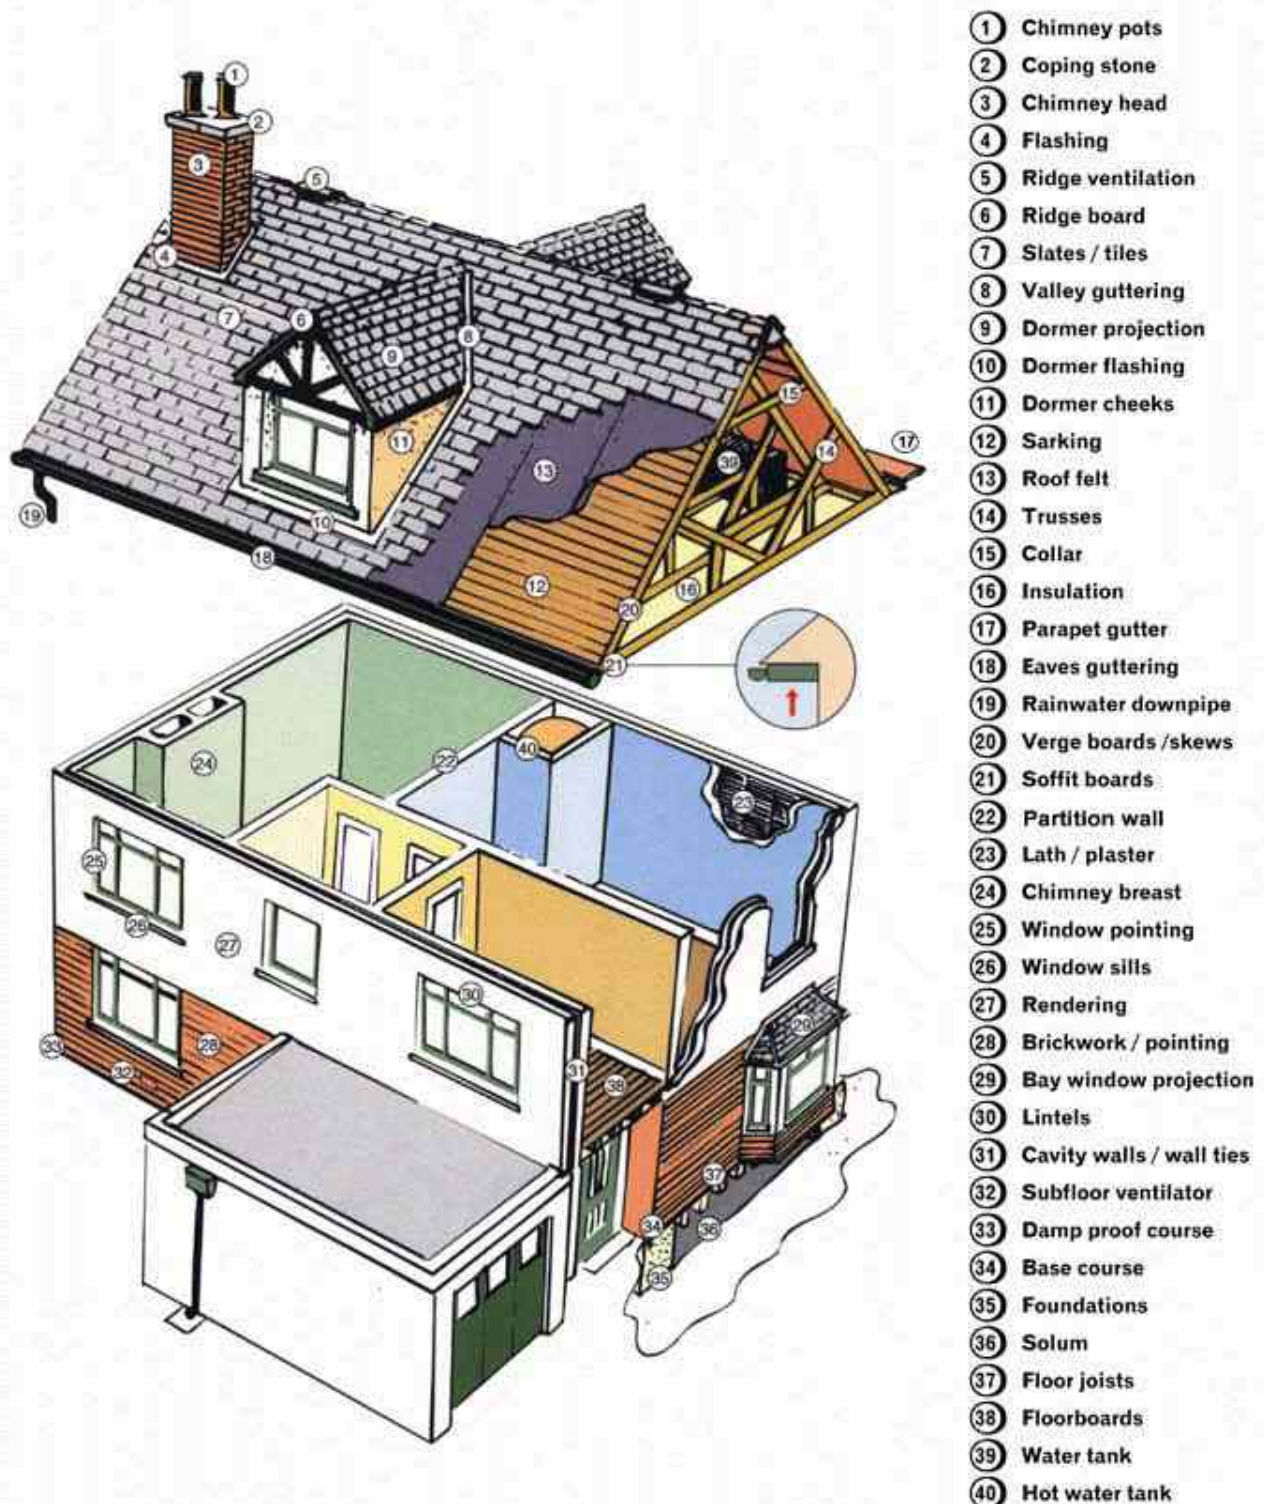

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.





# Single Survey


## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	Evidence of previous movement was noted within the property, however, within the limitations of the inspection we found no evidence to suggest that the movement appears to be serious or that there are obvious signs of recent movement.

 Dampness, rot and infestation	
Repair category	1
Notes	No dampness, rot or infestation noted.

 Chimney stacks	
Repair category	2
Notes	The chimney stacks appear to have been re-pointed in part, however, there are some areas of weathered and open pointing.

 Roofing including roof space	
Repair category	1
Notes	<p>Roof: The roof is clad with slate materials and will require ongoing and regular maintenance.</p> <p>The seller advised that the roof covering was completely re-slatted in 2015. All documentation and guarantees should be obtained and checked.</p> <p>Roof Space: There are some areas of historic damp staining to the underside of sarking board.</p>

# Single Survey



## Rainwater fittings

Repair category	1
Notes	The rainwater goods appear to be generally functional, however, will require ongoing maintenance.



## Main walls

Repair category	2
Notes	There are some areas of cracked and open pointing.



## Windows, external doors and joinery

Repair category	1
Notes	No reportable defects noted. The seller advised that window units were replaced in 2013.



## External decorations

Repair category	1
Notes	The external decorations are weathered in parts.



## Conservatories/porches

Repair category	-
Notes	None.



## Communal areas

Repair category	2
Notes	<p>There are areas of uneven flooring in the communal hallway. There is also some woodworm infestation affecting flooring at ground floor level.</p> <p>A timber and damp specialist can advise.</p>



## Garages and permanent outbuildings

Repair category	2
Notes	No internal access was available. Due to the age and construction of the outbuildings ongoing maintenance will be required to preserve wind and watertightness.



# Single Survey

	The former air raid shelter was covered with heavy vegetation growth.
--	---



## Outside areas and boundaries

<b>Repair category</b>	2
<b>Notes</b>	There are areas of cracked and uneven pointing to stone boundary walls.



## Ceilings

<b>Repair category</b>	1
<b>Notes</b>	The ceilings were found to be in a condition commensurate with age. There are some areas of uneven plasterwork.



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	Internal walls were found to be in a condition commensurate with age. There are some areas of uneven plasterwork.



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	No reportable defects noted. There are fitted floor coverings installed.



## Internal joinery and kitchen fittings

<b>Repair category</b>	1
<b>Notes</b>	The internal joinery items were found to be in a condition commensurate with age, consistent with recent use, showing some signs of general wear and tear.



## Chimney breasts and fireplaces

<b>Repair category</b>	1
<b>Notes</b>	Uncapped and unventilated chimney breasts will have a heightened risk from dampness and condensation.



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	The internal decorations were found to be in a condition commensurate with age.

# Single Survey



## Cellars

Repair category	-
Notes	None.



## Electricity

Repair category	2
Notes	<p>There is an older style fuse box installed.</p> <p>The Institution of Engineering and Technology recommends that inspection and testing are undertaken at least every 10 years and on a change of occupancy.</p>



## Gas

Repair category	1
Notes	It is common practice for an incoming purchaser to have gas supplies and appliances checked by a Gas Safe Heating Engineer, immediately upon taking occupation.



## Water, plumbing and bathroom fittings

Repair category	1
Notes	Seals around bath and shower areas can be frequently troublesome and require regular maintenance. Failure to seals can result in dampness, rot and decay to adjoining/underlying areas.



## Heating and hot water

Repair category	1
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet the current Regulations and Standards.



## Drainage

Repair category	1
Notes	No reportable defects noted. The system has not been tested.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	1
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	2
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Second
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed through an inspection of the Title Deeds.

The internal layout of the property does not appear to be original, in particular, the layout of the dining kitchen area. Whilst these works do not appear to be original, they do appear to be of some age and in excess of 20 years. They are considered to be historic.

### Estimated reinstatement cost for insurance purposes

£175,000 (ONE HUNDRED AND SEVENTY FIVE THOUSAND POUNDS).

### Valuation and market comments

£145,000 (ONE HUNDRED AND FORTY FIVE THOUSAND POUNDS).

Market Comments: At the time of inspection, the local property market appeared to be performing adequately, however, there has been an increase in the supply of property available for sale and of marketing periods following a downturn in the local market since late 2014. Most recently, local selling agents have reported an increase in viewing activity.

<b>Signed</b>	Security Print Code [562464 = 8271 ] Electronically signed
<b>Report author</b>	Paul F Delaney
<b>Company name</b>	DM Hall LLP
<b>Address</b>	259 Union Street, Aberdeen, AB11 6BR
<b>Date of report</b>	5th April 2018

# Mortgage Valuation Report



## Property Address

Address FLAT E, 6 HOSEFIELD ROAD, ABERDEEN, AB15 5NB  
Seller's Name Mr Steve Hardie  
Date of Inspection 29th March 2018

## Property Details

Property Type ☐ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette  
☒ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use  
☐ Other (specify in General Remarks)

Property Style ☐ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace  
☐ Back to back ☐ High rise block ☒ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided? ☐ Yes ☒ No  
No. of units in block

Approximate Year of Construction

## Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

## Garage / Parking / Outbuildings

☐ Single garage ☐ Double garage ☐ Parking space ☒ No garage / garage space / parking space  
Available on site? ☐ Yes ☐ No

Permanent outbuildings:

Former coal cellar, shared wash house and former air raid shelter.

# Mortgage Valuation Report

## Construction

Walls ☐ Brick ☒ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)  
Roof ☐ Tile ☒ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement? ☒ Yes ☐ No

If Yes, is this recent or progressive? ☐ Yes ☒ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None  
Electricity ☒ Mains ☐ Private ☐ None Gas ☒ Mains ☐ Private ☐ None  
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Gas fired boiler to radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☒ Rights of way ☒ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections  
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

## Location

☐ Residential suburb ☒ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial  
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered? ☒ Yes ☐ No

If Yes provide details in General Remarks.

## Roads

☐ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☒ Adopted ☐ Unadopted

# Mortgage Valuation Report

## General Remarks

Location: The property is situated within an established private and popular residential area within Midstocket, to the north west of Aberdeen City Centre. The location is convenient for local amenities.

The property was found to be in a condition commensurate with age and type.

Some items of maintenance and repair were noted which would require to be attended to in due course.

The property was occupied, furnished with floors covered. The inspection was consequently restricted.

Evidence of previous movement was noted within the property, however, within the limitations of the inspection we found no evidence to suggest that the movement appears to be serious or that there are obvious signs of recent movement.

Remarks: Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed through an inspection of the Title Deeds.

The internal layout of the property does not appear to be original, in particular, the layout of the dining kitchen area. Whilst these works do not appear to be original, they do appear to be of some age and in excess of 20 years. They are considered to be historic.

## Essential Repairs

None noted.

Estimated cost of essential repairs £  Retention recommended? ☐ Yes ☒ No Amount £



# Mortgage Valuation Report

## Comment on Mortgageability

The property provides suitable security for mortgage lending purposes.

## Valuations

Market value in present condition £ 145,000  
Market value on completion of essential repairs £   
Insurance reinstatement value £ 175,000  
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)  
Is a reinspection necessary? ☐ Yes ☒ No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £   
Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

## Declaration

Signed Security Print Code [562464 = 8271 ]  
Electronically signed by:-  
Surveyor's name Paul F Delaney  
Professional qualifications BSc (Hons) MRICS  
Company name DM Hall LLP  
Address 259 Union Street, Aberdeen, AB11 6BR  
Telephone 01224 594172  
Fax  
Report date 5th April 2018